



CENTRO
RICAMBI
S.R.L.

CIRCOLARE TECNICA



MARZO 1991
DATA

SERIE V850 - 1000

181/G.
N° PROGR.

1/1

DOPPIO GIUNTO CARDANICO

Per evitare la possibilità di usura con conseguente rotazione del doppio giunto cod. 17 32 80 50 nella sede del cuscinetto cod. 92 20 42 30 alloggiato sul forcellone oscillante, è stato variato il diametro della sede di accoppiamento del doppio giunto, prevedendo un montaggio con interferenza.



I doppi giunti esistenti a magazzino ricambi sono già modificati, fermo restando il relativo codice di ordinazione. Per facilitare il montaggio dei suddetti particolari è stato previsto un punch zone che può essere richiesto con il seguente codice di ordinazione:

DOUBLE JOINT

In order to avoid the possibility of wear and further rotation of the double joint ref. 17 32 80 50 into the seat of bearing ref. 92 20 42 30 (housed on the rear fork), it has been changed the diameter of the coupling-seat of the double joint, providing for an assembly with interference.

The double joint at present stored up are already modified, it being understood that the code number is unchanged. In order to make the assembly of the a.m. parts easier, it has been foreseen a punch, to be ordered as follows:

COD. 28 91 33 00 PUNZONE PER MONTAGGIO DOPPIO GIUNTO CARDANICO
PUNCH FOR DOUBLE JOINT ASSEMBLY

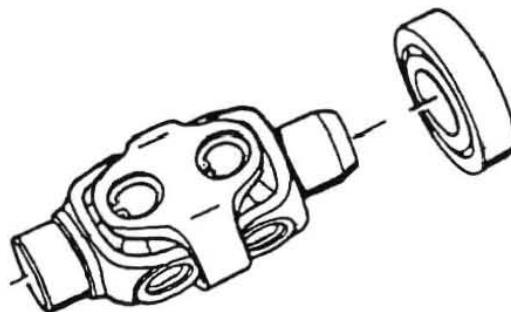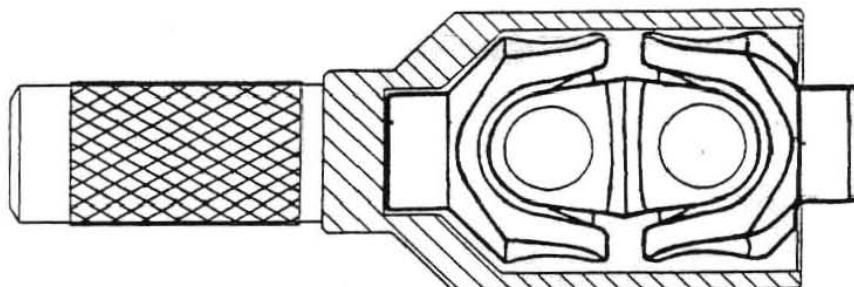

SERVIZIO ASSISTENZA CLIENTI

IL RESPONSABILE

(Giuseppe Neri)

G. Neri